Regency
the first name in solid state

PROFESSIONAL
2 WAY action radio

DATE 11/23/82

SSC Service Bulletin

no. 82-284

TO: ALL REGENCY COMMUNICATIONS PROFESSIONAL SALES & SERVICE CENTERS
ALL REGENCY COMMUNICATIONS PROFESSIONAL SALES REPRESENTATIVES

MODELS AFFECTED: MCPH251A, 256A, 401A, 406A, 601A, 606A

SYMPTOMS: LOSS OF RECEIVER SENSITIVITY

CAUSE: FAILURE OF R-4 AND/OR C-10 DUE TO VIBRATION OF P.C. BOARD

PRODUCTION CHANGES:

P/N 1601-1320-103, poly foam tape, will be installed in all future handhelds.

SOLUTION:

Attach poly foam tape to inside rear case as shown:

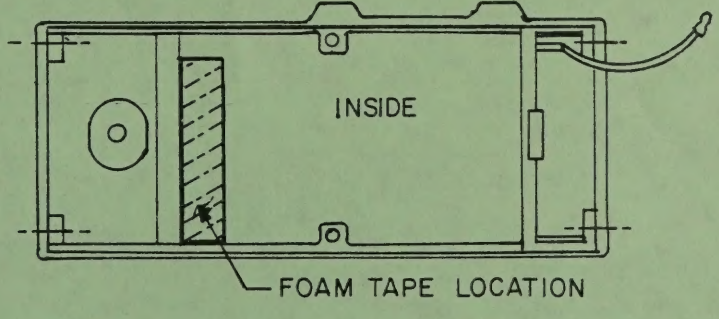

SERVICE MANUAL CHANGES:

Add P/N 1601-1320-103, poly foam tape, to Rear Case Parts List in your Micro-Com P Series Service Manual (0300-4164-300), Page 7, Section 11.

TECHNICAL SERVICE DEPARTMENT
REGENCY COMMUNICATIONS, INC.

AC 569